


## Corvus H89-Z37 re-work:

Issue: Corvus interface write signal fails to latch data on the Corvus data bus at proper time.

Solution: Use the available gates in U2 - 74LS14 pins to add more delay to the write signal.

Fix:

1. Cut trace on side 1 as shown

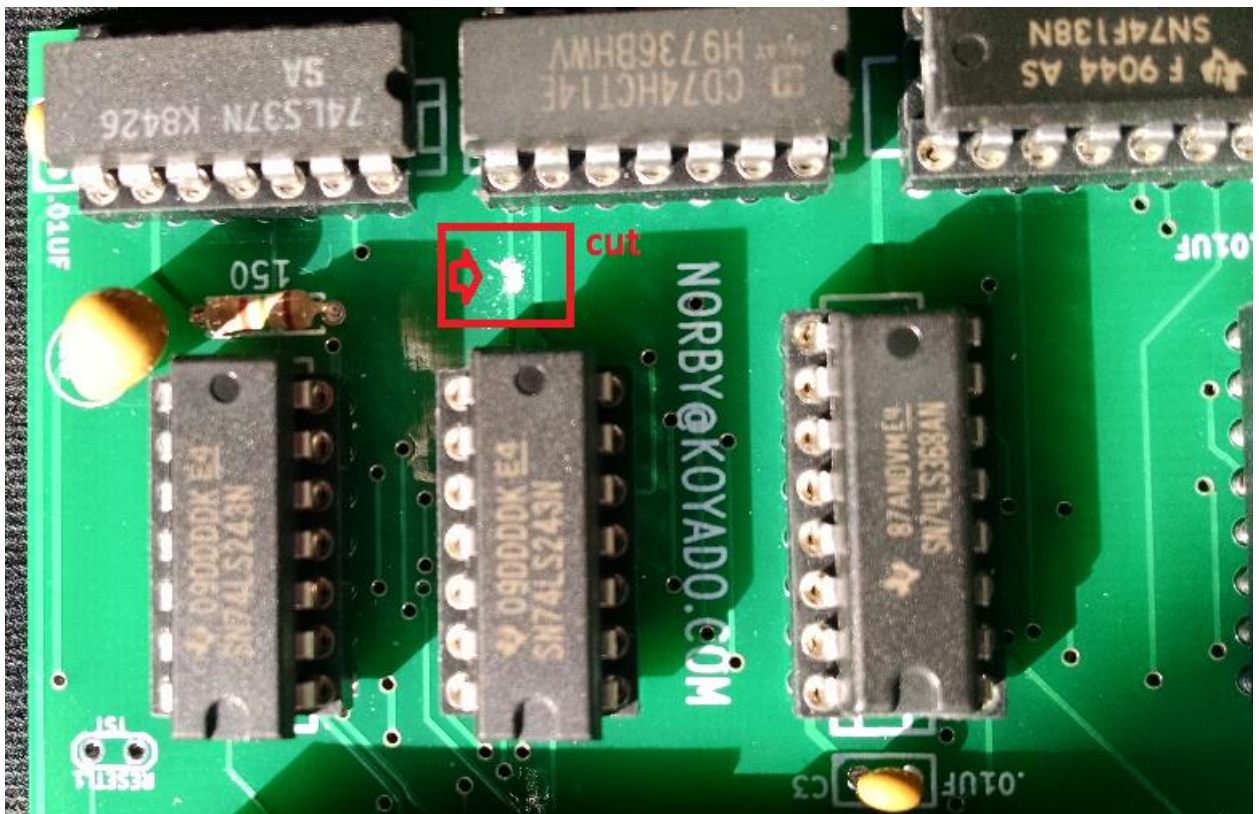

2. Solder wire from pin 8 to pin 13 of U2.
3. Solder wire from pin 12 to pin 11 of U2.
4. Solder wire from pin 10 of U2 to pin 1 of U3.
5. See picture below as a reference.

